

Planetary Gearheads

0,3 Nm


For combination with
DC-Micromotors
Brushless DC-Motors
Stepper Motors

Series 16/7

	16/7
Housing material	metal
Geartrain material	steel
Recommended max. input speed for:	
– continuous operation	5 000 min ⁻¹
Backlash, at no-load	≤ 1 °
Bearings on output shaft	ball bearings, preloaded
Shaft load, max.:	
– radial (6,5 mm from mounting face)	≤ 30 N
– axial	≤ 5 N
Shaft press fit force, max.	≤ 25 N
Shaft play	
– radial (6,5 mm from mounting face)	≤ 0,03 mm
– axial	= 0 mm
Operating temperature range	- 30 ... + 100 °C

Technical data		1	2	3	4	5	6
Number of gear stages							
Continuous torque	mNm	200	300	300	300	300	300
Intermittent torque	mNm	300	450	450	450	450	450
Mass without motor, ca.	g	18	23	28	33	38	43
Efficiency, max.	%	90	80	70	60	55	50
Direction of rotation, drive to output		=	=	=	=	=	=
Reduction ratio ¹⁾ (rounded)		3,71:1	9,7:1 14:1	43:1 66:1	94:1 112:1 134:1 159:1 190:1 246:1	415:1 592:1 989:1 1 526:1	2 608:1 4 365:1 5 647:1
L2 [mm] = length without motor		17,0	21,2	25,3	29,4	33,5	37,6
L1 [mm] = length with motor							
1516T...SR		32,8	37,0	41,1	45,2	49,3	53,4
1524T...SR		40,8	45,0	49,1	53,2	57,3	61,4
1624T...S		40,8	45,0	49,1	53,2	57,3	61,4
1717T...SR		34,0	38,2	42,3	46,4	50,5	54,6
1724T...SR		41,0	45,2	49,3	53,4	57,5	61,6
1727U...CXR		44,2	48,4	52,5	56,6	60,7	64,8
1741U...CXR		58,2	62,4	66,5	70,6	74,7	78,8
1628T...B		45,0	49,2	53,3	57,4	61,5	65,6
AM1524...55		33,4	37,6	41,7	45,8	49,9	54,0

¹⁾ The reduction ratios are rounded, the exact values are available on request or at www.faulhaber.com.

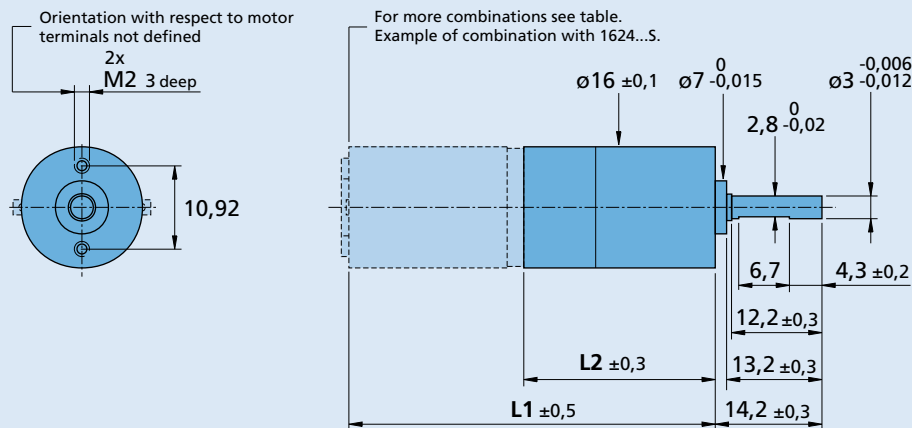

16/7